(19) World Intellectual Property Organization International Bureau





(43) International Publication Date 24 April 2003 (24.04.2003)

PCT

(10) International Publication Number WO 03/034054 A2

(51) International Patent Classification7:

G01N 27/00

- (21) International Application Number: PCT/GB02/04531
- (22) International Filing Date: 7 October 2002 (07.10.2002)
- (25) Filing Language:

English

(26) Publication Language:

English

(30) Priority Data:

0124910.1

17 October 2001 (17.10.2001) GB

0208960.5


19 April 2002 (19.04.2002) GB

- (71) Applicant (for all designated States except US): ACCENTUS PLC [GB/GB]; 329 Harwell, Didcot, Oxfordshire OX11 0QJ (GB).
- (72) Inventor; and
- (75) Inventor/Applicant (for US only): BUTTLE, David, John [GB/GB]; 29 Upthorpe Drive, Wantage, Oxfordshire OX12 7DF (GB).

- (74) Agents: MANSFIELD, Peter, Turquand et al.; c/o Accentus plc, Patents Dept, 329 Harwell, Didcot, Oxfordshire OX11 0QJ (GB).
- (81) Designated States (national): AE, AG, AL, AM, AT, AU, AZ, BA, BB, BG, BR, BY, BZ, CA, CH, CN, CO, CR, CU, CZ, DE, DK, DM, DZ, EC, EE, ES, FI, GB, GD, GE, GH, GM, HR, HU, ID, IL, IN, IS, JP, KE, KG, KP, KR, KZ, LC, LK, LR, LS, LT, LU, LV, MA, MD, MG, MK, MN, MW, MX, MZ, NO, NZ, OM, PH, PL, PT, RO, RU, SD, SE, SG, SI, SK, SL, TJ, TM, TN, TR, TT, TZ, UA, UG, US, UZ, VN, YU, ZA, ZM, ZW.
- (84) Designated States (regional): ARIPO patent (GH, GM, KE, LS, MW, MZ, SD, SL, SZ, TZ, UG, ZM, ZW), Eurasian patent (AM, AZ, BY, KG, KZ, MD, RU, TJ, TM), European patent (AT, BE, BG, CH, CY, CZ, DE, DK, EE, ES, FI, FR, GB, GR, IE, IT, LU, MC, NL, PT, SE, SK, TR), OAPI patent (BF, BJ, CF, CG, CI, CM, GA, GN, GQ, GW, ML, MR, NE, SN, TD, TG).

[Continued on next page]

(54) Title: MEASUREMENT WITH A MAGNETIC FIELD

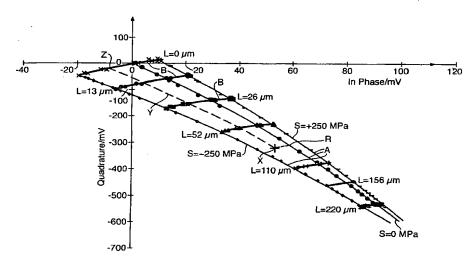

(57) Abstract: Material properties such as stress in a ferromagnetic material may be measured using an electromagnetic probe. While generating analternating magnetic field in the object, and sensing the resulting magnetic field with a sensor, the signals from the magnetic sensor may be resolved into in-phase and guadrature components. The signals are affected by both geomaterical parameters such as lift-off and by material properties, but these influences may be separated by mapping the in-phase and quadrature components directly into material property and lift-off components, and hence a material property and/or the lift-off may be determined. The mapping may be represented in the impedance plane as two sets of contours representing signal variation with lift-off (A) (for different values of stress) and signal variation with stress (B) (for different values of lift-off), the contours of both sets (A, B) being curved. The stress contours (B) at a constant angle. Hence calibration measurements taken along a few contours of each set enable





Declarations under Rule 4.17:

as to applicant's entitlement to apply for and be granted a patent (Rule 4.17(ii)) for the following designations AE, AG, AL, AM, AT, AU, AZ, BA, BB, BG, BR, BY, BZ, CA, CH, CN, CO, CR, CU, CZ, DE, DK, DM, DZ, EC, EE, ES, FI, GB, GD, GE, GH, GM, HR, HU, ID, IL, IN, IS, JP, KE, KG, KP, KR, KZ, LC, LK, LR, LS, LT, LU, LV, MA, MD, MG, MK, MN, MW, MX, MZ, NO, NZ, OM, PH, PL, PT, RO, RU, SD, SE, SG, SI, SK, SL, TJ, TM, TN, TR, TT, TZ, UA, UG, UZ, VN, YU, ZA, ZM, ZW, ARIPO patent (GH, GM, KE, LS, MW, MZ, SD, SL, SZ, TZ, UG, ZM, ZW), Eurasian patent (AM, AZ, BY, KG, KZ, MD, RU, TJ, TM), European patent (AT, BE, BG, CH, CY, CZ, DE, DK, EE, ES, FI, FR, GB,

GR. IE, IT, LU, MC, NL, PT, SE, SK, TR), OAPI patent (BF, BJ, CF, CG, CI, CM, GA, GN, GQ, GW, ML, MR, NE, SN, TD, TG)

- of inventorship (Rule 4.17(iv)) for US only

Published:

 without international search report and to be republished upon receipt of that report

For two-letter codes and other abbreviations, refer to the "Guidance Notes on Codes and Abbreviations" appearing at the beginning of each regular issue of the PCT Gazette.

Measurement with a Magnetic Field

This invention relates to a method and apparatus in which an electromagnetic probe is used to measure

material properties in a ferromagnetic material, for example stress, or to measure the separation of the probe from the surface of such a material.

The stresses in structures such as rails, bridges 10 and pipelines, complex mechanisms such as vehicles and machinery, or simple devices such as struts, cables or bearings arise from various causes including changes of temperature, and the loads and pressures due to use. There may also be residual stresses arising from the fabrication of the structure or device, and any bending 15 that the structure or device was subjected to during construction; the residual stresses arising from fabrication will also be affected by any stress-relieving heat treatment. In some situations (such as pipelines) 20 the principal stress directions can be expected to be in particular directions (circumferential and longitudinal), whereas in other situations the stress directions are also unknown. A variety of magnetic techniques are known to have some sensitivity to stress, although magnetic 25 measurements are usually also affected by other material properties such as microstructure. A way of measuring stress in a steel plate is described in GB 2 278 450, this method using a probe containing an electromagnetic core to generate an alternating magnetic field in the 30 plate, and then combining measurements from two sensors, one being a measure of stress-induced magnetic anisotropy, and the other being a measure of directional effective permeability (DEP). The probe is gradually turned around so the magnetic field has a plurality of different orientations in the plate, and these 35 measurements are taken at each such orientation. The DEP

signals are affected not only by stress, but also by the lift-off from the surface (i.e. the gap or separation between the probe and the surface), and so must be corrected for lift-off.

5

According to the present invention there is provided an apparatus comprises at least one probe for measuring material properties in an object of ferromagnetic material and/or measuring the lift-off of the probe from 10 the surface of the object, the or each probe comprising an electromagnet means, means to generate an alternating magnetic field in the electromagnet means and consequently in the object, and a magnetic sensor arranged to sense a magnetic field due to the electromagnet means; analysis means for resolving signals 15 from the magnetic sensor into a first component and a second component which are orthogonal in phase; means for mapping the first and second components directly into material property and lift-off components; and means for deducing a material property from the material property 20 component so determined, and/or a lift-off value from the lift-off component so determined.

The mapping requires a preliminary calibration, with a specimen of the material, to determine how the first and second components of the signal vary with lift-off (at a constant stress) and vary with stress (at a constant lift-off), and deducing from the calibration measurements the applicable mapping for any stress and any lift-off. The signals from the sensor are at the frequency of the alternating field, and the components may be the components in phase with the current supplied to the electromagnet means, and the component in quadrature to that. The mapping may be represented in the impedance plane (i.e. on a graph of quadrature component against in-phase component) as two sets of

contours representing signal variation with lift-off (for different values of stress) and signal variation with stress (for different values of lift-off), the contours of both sets being curved. The contours or lines of one set intersect those of the other set at non-orthogonal angles. The angles at which the contours for constant lift-off (varying stress) intersect any one contour for constant stress (varying lift-off) are constant along that contour. However the angles of intersection of different lift-off lines with any one stress line are different: the angle of intersection at a fixed lift-off varies slightly with stress. Hence measurements taken along a few contours of each set enable the positions of the other contours of each set to be determined.

15

10

Surprisingly this simple mapping has been found to give an accurate representation of the variation of the signals with material property (e.g. stress or microstructure); more surprisingly it enables these variations to be distinguished unambiguously from variations arising from lift-off or other geometrical variations such as surface texture or curvature. It may perhaps be presumed that material property changes cause changes in the permeability of the steel in the magnetic 25 circuit and these have both inductive and resistive (lossy) components, whereas geometrical changes such as lift-off change the amount of air in the magnetic circuit, in which energy dissipation by eddy currents cannot occur, so this of itself would by purely inductive (non-lossy). Where the object has a coating of a non-30 ferromagnetic material (such as a paint, or a ceramic), this coating will separate the probe from the surface, so the lift-off measurement may indicate its thickness.

Preferably the electromagnet means comprises an electromagnetic core and two spaced apart electromagnetic

poles, and the magnetic sensor is preferably arranged to sense the reluctance of that part of the magnetic circuit between the poles of the electromagnet means. It is also desirable to arrange for such measurements to be taken with a plurality of different orientations of the magnetic field, at a single location on the object. may be achieved using a single probe that is rotated at that location, measurements being taken with different orientations of the probe, or using an array of probes of 10 different orientations that are successively moved to that location. In either case, the sensor or sensors provide a measure of the permeability of the material through which the flux passes between the poles, and so provide a signal indicative of the effective permeability 15 of the material; the corresponding measurements at different probe orientations at a location on the object hence indicate the effective permeability in different directions. The signals from this sensor may be referred to as a reluctance, or 'flux linkage', signal.

20

25

30

The probe, or at least some of the probes, may also include a second magnetic sensor between the two poles and arranged to sense magnetic flux density perpendicular to the direction of the free space magnetic field between the poles. This second sensor would detect no signal if the material were exactly isotropic; however stress induces anisotropy into the magnetic properties of the material, and so the signals received by the second sensor are a measure of this stress-induced magnetic anisotropy or 'flux rotation'. The variations in the flux rotation signals at different probe orientations, at a location on the object, enable the directions of the principal stress axes to be accurately determined. The flux rotation signals can also be related to the stress.

35

The flux linkage signal from the or each probe is

WO 03/034054 PCT/GB02/04531

- 5 -

preferably backed-off, i.e. processed by first subtracting a signal equal to the signal from that sensor with the probe adjacent to a stress-free location. The backed-off signal is then amplified so the small changes in the flux linkage signal due to stress are easier to detect. This backing off is performed after resolving into in-phase and quadrature components but before performing the mapping. Preferably the signals from the or each probe are digitized initially, and the backing-off and resolution are performed by analysis of the digital signals.

To achieve penetration below the surface of the ferromagnetic object it is desirable to operate at alternating frequencies less than 200 Hz, for example 15 between 5 Hz and 100 Hz (which in mild steel provide penetrations of about 5 mm and 1 mm respectively). In other situations, where such depth of penetration is not required, higher frequencies can be used, for example up 20 to 150 kHz for a penetration of only about 15 μm. depth of penetration may be represented by the skin $\delta = 1/\sqrt{(\pi \mu_0 \mu_r f k)}$, where μ_0 is the permeability of free space, μ_r is the relative permeability of the material, k is its electrical conductivity, and f is the 25 frequency. The frequency should be such that the skin depth is much less than the thickness of the object.

Generally, the more different probe orientations are used for taking measurements the more accurate the determination of stress levels and principal axes can be. In many cases the principal stress axes can be assumed to be aligned in particular directions - axial and circumferential directions in the case of a pipe, for example - so that the signal maxima for flux linkage signals would be expected to be along these directions,

and the signal maximum for flux rotation signals would be along the bisection angles between these directions.

The probe, or at least some of the probes, may also include a third magnetic sensor (a 'flux leakage' sensor) between the poles and arranged to sense magnetic flux density parallel to the free space magnetic field. This third sensor will detect any flux leakage, this being influenced by changes in material properties, lift-off, and cracks. As with the flux-linkage sensor, measurements at a location are preferably made at different probe orientations.

The invention will now be further and more

15 particularly described, by way of example only, and with
reference to the accompanying drawings, in which:

Figure 1 shows a diagrammatic view of an apparatus for measuring stress or lift-off;

20

Figure 2 shows a longitudinal sectional view of a probe for use in the apparatus of figure 1;

Figure 3 shows graphically the variation of the backed-off quadrature and in-phase components of the flux linkage signal with variations of lift-off, and with variations of stress.

Referring to figure 1, an apparatus 10 for measuring stress and/or lift-off includes a sensor probe 12 comprising sensors for both flux linkage and flux rotation, the probe 12 being attached to an electric motor 14 which can be held by an operator, so the motor 14 can turn the probe 12 with one end adjacent to a surface of a steel object 16 in which the stress is to be determined. The sensor probe 12 and motor 14 are

connected by a 2 m long umbilical cable 17 to a signal conditioning/probe driver unit 18. The unit 18 is connected by a long umbilical cable 19 (which may for example be up to 300 m long) to an interface unit within 5 a microcomputer 20, which has a keyboard 21. Operation of the apparatus 10 is controlled by software in the microcomputer 20.

The interface unit within the microcomputer 20 generates sine and cosine functions at an angular frequency selectable by software, and buffers the sine waveform for transmission to the unit 18 for driving the probe 12. The amplitude of the transmitted waveform is also selectable by software. It also provides signals to control the motor 14 and hence the angular position of the probe 12. The interface unit also provides control signals to the unit 18 to select which of the signals available from the probe 12 is to the transmitted for analysis. It demodulates the selected input signal (flux linkage or flux rotation) to derive its in-phase and quadrature components, filters the demodulated signal to remove high frequency components and to reduce noise, and converts the analogue signals to digital form for input to the computer 20. It also detects the angular position 25 of the probe 12 from signals provided by a position encoder (not shown) on the motor 14.

The long umbilical cable 19 incorporates a coaxial cable to transmit the selected signal, and wires to control which signal is selected, to control the motor 14, to transmit signals from the position encoder, to transmit the sinusoidal waveform, and to convey electrical power. The unit 18 converts the drive waveform from a voltage to a current drive for the probe 12; buffers and amplifies the signals from the probe 12; and selects which signal is to be transmitted to the

WO 03/034054 PCT/GB02/04531

- 8 -

microcomputer 20. It also buffers the signals from the position encoder for transmission, and drives the motor 14 in response to control signals.

Referring now to figure 2, the probe 12 is shown 5 detached from the motor 14, in longitudinal section although with the internal components shown in elevation (the connecting wires within the probe 12 are not shown). The probe 12 comprises a cylindrical brass casing 24 of 10 external diameter 16.5 mm and of overall height 60 mm, the upper half being of reduced diameter whereby the probe 12 is attached to the motor 14. The upper half of the casing 24 encloses a head amplifier 25. The lower half encloses a U-core 26 of laminated mu-metal (a high permeability nickel/iron/copper alloy) whose poles 28 are separated by a gap 7.5 mm wide, and are each of width 2.5 mm, and of thickness 10 mm (out of the plane of the The poles 28 are in the plane of the lower end of the casing 24, which is open. Around the upper end of 20 the U-core 26 is a former on which are wound two superimposed coils 30. One coil 30a (which has 200 turns) is supplied with the sinusoidal drive current from the unit 18; the other coil 30b (which has 70 turns) provides flux linkage signals. Between the two poles 28 is a former on which is wound a 1670-turn rectangular 25 coil 32, about 4 mm high and 6 mm wide, and 6 mm-square as seen from below, the windings lying parallel to the plane of the figure so the longitudinal axis of the coil 32 is perpendicular to the line between the centres of the poles 28. The coil 32 is supported by a support plate 34 fixed between the arms of the U-core 26 so the lower face of the coil 32 is in the plane of the poles The coil 32 provides the flux rotation signals. signals from the coils 30b and 32 are amplified by the head amplifier 25 before transmission to the unit 18.

On the same former as the coil 32 there may also be wound a 200-turn rectangular coil whose windings are perpendicular to the plane of the figure so the axis of the coil is parallel to the line between the centres of the poles. This coil would provide flux leakage signals. Alternatively such a flux leakage coil may be provided somewhat further from the surface, for example above the support plate 34.

In operation of the system 10, the motor 14 is 10 supported so the lower end of the probe 12 is adjacent to the surface of the object 16 and the longitudinal axis of the probe 12 is normal to the surface. An alternating current of the desired frequency and amplitude is 15 supplied to the drive coil 30a, so the magnetic field in the object 16 oscillates about zero with an amplitude much less than saturation. The probe 12 is first placed adjacent to a region of the object 12 where the stresses are negligible. The in-phase and quadrature components of 20 the flux linkage signal (i.e. the component in phase with the drive current, and the component at 90° to the drive current) received by the microcomputer 20 are each backed off to zero, and the backing off values are then fixed. During all subsequent measurements the flux linkage signal components are backed off by these same amounts 25 (i.e. subtracting a signal equal to the component observed when in a stress-free location).

Measurements can be taken by placing the probe 12

30 adjacent to a region in which material properties such as stress are to be measured. The orientation of the line joining the centres of the poles 28 (referred to as the orientation of the probe 12) is noted relative to a fixed direction on the surface. The motor 14 is then energized to rotate the probe 12, for example in a step-wise fashion 10° at a time through a total angle of 360°. At

WO 03/034054 PCT/GB02/04531

- 10 -

each orientation of the probe 12 the quadrature flux rotation signal is measured, and the flux linkage components are measured (and backed off). These measurements may be made at different frequencies, for example with a drive current frequency of 68 Hz when measuring flux rotation, and at a frequency of 300 Hz when measuring flux linkage. More typically the drive current frequency would be the same when measuring both parameters.

10

15

20

It will be appreciated that the signal analysis procedure of the invention is applicable with many different probes. The probe 12 might for example be modified by using a U-core 26 of a different material such as silicon iron (which can provide higher magnetic fields), or indeed the drive coil might be air-cored.

The probe might be of a different shape or size, for example for inspecting surface stress in a small bearing it may be appropriate to use a probe of diameter as small as 3 mm, and to operate at a higher frequency such as 100 kHz, while for inspecting internal stresses in a large steel pipe it may be appropriate to use a probe of diameter say 75 mm.

25

30

35

The flux rotation signals vary sinusoidally with probe orientation, so the orientation at which they have their maxima and minima can be determined. The directions midway between these two orientations are the directions of the principal stress axes. Measurements of the flux rotation signals are therefore useful if the principal stress directions are unknown. The flux linkage and flux leakage signals also vary sinusoidally with probe orientation (in antiphase with each other) and the values are observed at the principal stress directions. If the principal stress directions are already known,

WO 03/034054 PCT/GB02/04531

- 11 -

then the probe 12 might instead be merely oriented to those directions, and the flux linkage measurements made; no rotation of the probe 12 would be necessary.

The values of the stresses in the directions of the principal stress axes can be determined from the experimental measurements of the flux linkage signals with the probe 12 oriented in those directions. This requires calibration of the apparatus 10, taking measurements on a sample of material of the same type as 10 that of the object 16, while subjecting it to a variety of different stresses. This may be done with a rectangular strip sample in a test rig, measurements being made at the centre of the sample where the principal stress direction is aligned with the axis of the test riq. Referring to figure 3 this shows the backed-off flux linkage in-phase and quadrature components obtained in such a test rig, the measurements being made with a drive frequency of 70 Hz, and the specimen being a steel bar. A first set of measurements were made at progressively larger values of lift-off, L, but with no stress, S. This gives the lift-off line or contour A, the lift-off varying between 0 and 220 μm . Similar lift-off lines A are obtained for other fixed values of stress, those for S = 250 MPa tension and 25 compression being shown. Measurements were then made at a range of different fixed values of lift-off, L, with varying stresses, S (both compression and tension), providing the contours B.

30

It will be appreciated that the contours A are curved, and the contours B are not orthogonal to the contours A, but that they intersect at angles that are constant along any one lift-off line A. Consequently it is only necessary to make calibration measurements sufficient to plot one such contour B and two or three

such contours A, and the shapes of the other contours can be predicted. It has also been found that the intersection angles, and the curvature of the contours, are characteristic of the material.

5

After calibrating the probe 12 in this manner, measurements of stress or of lift-off can be readily made from observations of flux linkage signals (resolved and backed off), as the contours enable the changes due to lift-off to be readily distinguished from changes due to 10 stress. Any particular position in the impedance plane (i.e. in the graph of quadrature against in-phase components) corresponds to a particular value of stress and a particular value of lift-off. The mapping between (in-phase, quadrature) coordinates and (stress, lift-off) 15 coordinates may be carried out graphically, referring to such contours, or by calculation. For example if the flux linkage signal has the in-phase and quadrature components of the position marked X, this corresponds to 20 a lift-off of about 80 µm and a stress of about -125 MPa. Alternatively the value X may be translated along a contour B of constant lift-off to find the two components (at position R) for zero stress, and so to find the liftoff. Similarly this value X may be translated (along the broken line Y) along a contour A of constant stress to find the in-phase and quadrature components at position ${\tt Z}$ for zero lift-off.

Determination of the positions R and Z may be

30 carried out graphically, as shown in the figure.

Another method is to deduce theoretical equations for how
the signal will vary with lift-off and material
properties, taking into account the reluctance of the
three parts of the magnetic circuit: the U-core 26, the

35 air gaps, and the magnetic path through the object 16.
To provide an accurate fit to the experimental data, it

would be desirable also to take into account any losses in the core 26 and hysteresis losses in the object 16, and also flux leakage. Alternatively, simple polynomials may be used to model the experimental measurements; although this approach provides little insight into the physical phenomena it has been found to be the most accurate approach. This latter approach may be modified, based on the experimental observation that the intersection angles along any lift-off line and a set of stress lines remains constant.

The contours of constant stress, σ (referred to as

lift-off lines) and contours of constant lift-off, L (referred to as material or stress lines) constitute a non-linear two-dimensional matrix on the impedance plane. The requirement is to determine for any subsequent impedance measurement the independent vector lengths on the impedance plane corresponding to a change in material and a change in lift-off. That is to say, the

20 measurement, (xm,ym) corresponding to the position X must be separated into the two specific components (x'o,y'o) at position Z, and (x'L,y'L) at position R, where these two components must lie on the zero lift-off stress line and the zero stress lift-off line respectively.

25

This analysis may be achieved in the following stages:

- (A) General analysis for the lift-off/stress matrix 30 measurements
 - (1) The lift-off/stress matrix is parameterised using simple polynomial equations. Typically this matrix may

consist of between 3 and 5 lift-off lines and between 5 and 10 stress lines.

- (2) All the intercepts between the lift-off and stress lines are then determined.
- (3) Cubic fits are carried out for both in-phase and quadratic intercept values against the actual lift-off levels used when measuring the original stress lines 10 (provided there are at least 4 measured stress lines).
 - (4) Stress lines can then be evaluated for any arbitrary lift-off using the cubic fit coefficients (provided there are at least 3 measured lift-off lines).

15

- (B) Specific analysis for each subsequent measurement X
- (5) A new lift-off line is evaluated which passes exactly through the measurement point.

20

- (6) The intersection, Z, of this new lift-off line with the zero lift-off stress line is determined, $(x'_{\sigma}, y'_{\sigma})$.
- (7) Find the stress line that passes exactly through the 25 measurement point.
 - (8) The intersection, R, of this new stress line with the zero stress lift-off line is determined, (x'_L, y'_L) .
- 30 (9) Alternatively if stages (3) and (4) have been carried out then the new stress line can be compared to the cubic fit coefficients to determine the absolute lift-off level.

The above approach will now be described in greater detail, using the numbering of the steps given above.

(1) All the lift-off (x_L, y_L) and stress (x_σ, y_σ) lines are first fitted with quadratic equations:

$$y_L(\sigma) = a_L(\sigma)x_L^2 + b_L(\sigma)x_L + c_L(\sigma)$$
 (1)

10 (where the coefficients are different for each different value of σ), and

$$y_{\sigma}(L) = a_{\sigma}(L)x_{\sigma}^{2} + b_{\sigma}(L)x_{\sigma} + c_{\sigma}(L)$$
(2)

15 (where the coefficients are different for each different value of lift-off)

It can be useful to evaluate the intersection angle between the lift-off and stress lines, γ , at an arbitrary intersection position (x',y'):

$$\tan \gamma = \frac{2(a_L(\sigma) - a_\sigma(L))x' + (b_L(\sigma) - b_\sigma(L))}{1 + (2a_\sigma(L)x' + b_\sigma(L))(2a_L(\sigma)x' + b_L(\sigma))}$$
(3)

For the lift-off lines we shall specifically
25 identify the most extreme cases that mark the edges of
the matrix, for example those for compressive and tensile
stresses of 250 MPa in the figure.

$$y_L(\sigma_c) = a_L(\sigma_c)x_L^2 + b_L(\sigma_c)x_L + c_L(\sigma_c)$$
(4)

30

where σ_{C} is always the largest compression, and

$$y_L(\sigma_t) = a_L(\sigma_t)x_L^2 + b_L(\sigma_t)x_L + c_L(\sigma_t)$$
(5)

where σ_t is the largest tensile stress (or at any rate the tensile stress giving the largest difference in signal from that at zero stress). Also the lift-off line measured at zero applied stress,

$$y_{t}(0) = a_{t}(0)x_{t}^{2} + b_{t}(0)x_{t} + c_{t}(0)$$
(6)

10 For the stress lines we shall identify the one at zero lift-off,

$$y_{\sigma}(0) = a_{\sigma}(0)x_{\sigma}^{2} + b_{\sigma}(0)x_{\sigma} + c_{\sigma}(0)$$
(7)

15 (2) The intercepts between measured lift-off and stress lines are determined by setting (x_L, y_L) and (x_σ, y_σ) equal to $(x_{\sigma L}, y_{\sigma L})$ in equations (1) and (2), and solving using the fitted polynomial coefficients:

$$20 \quad \mathbf{x}_{\sigma L} = \frac{\left(\mathbf{b}_{\sigma}(\mathbf{L}) - \mathbf{b}_{L}(\sigma)\right) \pm \sqrt{\left(\mathbf{b}_{L}(\sigma) - \mathbf{b}_{\sigma}(\mathbf{L})\right)^{2} - 4\left(\mathbf{a}_{\sigma}(\mathbf{L}) - \mathbf{a}_{L}(\sigma)\right)\left(\mathbf{c}_{\sigma}(\mathbf{L}) - \mathbf{c}_{L}(\sigma)\right)}}{2\left(\mathbf{a}_{\sigma}(\mathbf{L}) - \mathbf{a}_{L}(\sigma)\right)}$$
(8)

then
$$y_{\sigma L}$$
 from (1) or (2). (9)

- Care must be taken to select the solution of equation (8) which lies within the bounds of the lift-off /stress matrix.
 - (3) The intercepts, $(x_{\sigma L}, y_{\sigma L})$, along each lift-off line are fitted to cubic equations to parameterise the true lift-off values using the 5 to 10 experimental lift-off values.

$$x_{\sigma L} = p_x(\sigma)L^3 + q_x(\sigma)L^2 + r_x(\sigma)L + s_x(\sigma)$$
(10)

$$y_{\sigma L} = p_{y}(\sigma)L^{3} + q_{y}(\sigma)L^{2} + r_{y}(\sigma)L + s_{y}(\sigma)$$
(11)

5

where the two sets of coefficients p, q and r for x and y are numbers that are different for each value of stress (three in this example).

- 10 (4) A general complete set of stress lines can then be determined using the coefficients in equations (10) and (11) for all lift-offs within the measurement range and for small extrapolations beyond that range. I.e.
 - evaluate general $(x_{\sigma L}, y_{\sigma L})$ using equations (10) and (11)
- for each measured lift-off line, then for each lift-off, L=L', collect all intercepts $(x_{\sigma L'},y_{\sigma L'})$ and fit quadratics to these as in equation (2) but now we have generated stress lines for all specified lift-off values, these lines making smooth transitions between the
- 20 measured stress lines.
 - (B) Specific analysis for each measurement on component or plant.
- 25 (5) For a measurement (x_m, y_m) , the lift-off line which passes directly through it can be expressed as (referring to equations (4) (6)):

$$y_{L} = [a_{L}(0) + \Delta(a_{L}(\sigma_{t}) - a_{L}(\sigma_{c}))]x_{L}^{2} + [b_{L}(0) + \Delta(b_{L}(\sigma_{t}) - b_{L}(\sigma_{c}))]x_{L} + [c_{L}(0) + \Delta(c_{L}(\sigma_{t}) - c_{L}(\sigma_{c}))]$$
(12)

30

where the parameter, Δ , represents the relative position across the lift-off/stress matrix along the stress lines, and is given by:

$$\Delta = \frac{y_m - a_L(0)x_m^2 - b_L(0)x_m - c_L(0)}{\left[(a_L(\sigma_t) - a_L(\sigma_c))x_m^2 + (b_L(\sigma_t) - b_L(\sigma_c))x_m + (c_L(\sigma_t) - c_L(\sigma_c)) \right]}$$
(13)

In equation (12) the expressions within square brackets are numerical coefficients, say A_1 , B_1 and C_1 . This parameter Δ effectively subdivides the area where there are contours, giving equally spaced lift-off lines with a smooth variation, based on just three measured lift-off lines. Note that this analysis does not use the information determined in steps (2), (3), or (4) above.

15 (6) The intersection of the specific lift-off line (12) with the zero lift-off stress line, (7), $(x'_{\sigma}, y'_{\sigma})$, is given by:

$$x'_{\sigma} = \frac{\left(b_{\sigma}(0) - B_{1}\right) \pm \sqrt{\left(B_{1} - b_{\sigma}(0)\right)^{2} - 4\left(a_{\sigma}(0) - A_{1}\right)\left(C_{\sigma}(0) - C_{1}\right)}}{2\left(a_{\sigma}(0) - A_{1}\right)}$$
(14)

20 then y'_{σ} from equation (7) by substitution. (15)

Here again care must be taken to select the correct solution.

25 (7-9) Find the stress line that passes exactly through the measurement point. In step (4) above, all general stress lines (and their coefficients) were determined. Therefore it is only necessary to determine which line includes the measurement point, (x_m, y_m) . There are 30 several ways to do this, one being to determine the shortest distance, D, from the point to each stress line:

$$D(L) = \sqrt{(x_m - x *_{\sigma} (L))^2 + (y_m - y *_{\sigma} (L))^2}$$
 (16)

where the $(x*_{\sigma},y*_{\sigma})$ are the closest corresponding positions on each stress line given by the solution to the simultaneous equations:

$$y_{\sigma}^{*}(L) - y_{m} = \frac{x_{m} - x_{\sigma}^{*}(L)}{2a_{\sigma}(L)x_{\sigma}^{*}(L) + b_{\sigma}(L)}$$
(17)

$$(2a_{\sigma}(L)x_{\sigma} *(L) + b_{\sigma}(L))(a_{\sigma}(L)x_{\sigma}^{2} *(L) + b_{\sigma}(L)x_{\sigma} *(L) + c_{\sigma}(L) - y_{m}) + (x_{\sigma} *(L) - x_{m}) = 0$$

$$(18)$$

Thus for the range of L we find D(L)_{min} and so determine the absolute lift-off, L, for the measurement.

An advantage of this method, using stress lines determined using the coefficients in equations (10) and (11) for all different values of lift-off (as outlined in step (4) above), is that it makes use of data from all the different experimentally-determined stress lines (of which there are seven shown in the figure, from L= 0 to L=220 μ m).

Alternatively if absolute lift-off value are not used and stages (3) and (4) have not been carried out, then by working with polynomial intersections in a manner analogous to that for the lift-off lines, the intersection point R can be obtained.

An alternative analysis approach takes into account the experimental observation of a constant intersection angle, γ , along each lift-off line, in determining the equations of the lift-off lines and stress lines. The result is more robust to extrapolation beyond the

calibrated lift-off range and requires fewer measurements of stress and lift-off lines to construct.

The measured lift-off lines are fitted with simple quadratic equations as described by equations (4) to (7). These are typically taken so as to represent the two extreme values of stress and the zero stress lift-off line respectively (three lines, although more can be used). Only a single stress line needs to be measured, and this can be at any lift-off, L_0 , equation (2). The intersection angles, $\gamma(\sigma)$, of the lift-off lines along the stress line are evaluated from equation (3). Let the tangent angle to any lift-off line be $\alpha_L(\sigma)$ and that to the stress line be $\beta_{\sigma}(L_0)$. Then:

15

$$\tan \alpha_L(\sigma) = 2a_L(\sigma)x_L + b_L(\sigma) \tag{19}$$

$$\tan \beta_{\sigma}(L_{0}) = \tan(\alpha_{L}(\sigma) - \gamma(\sigma)) = \tan[\tan^{-1}(2a_{L}(\sigma)x_{L} + b_{L}(\sigma)) - \gamma(\sigma)] = 2a_{\sigma}(L_{0})x_{L} + b_{\sigma}(L_{0})$$
(20)

20

Expanding the more complicated tangent in equation (20):

$$\frac{2a_L(\sigma)x_L + b_L(\sigma) - \tan\gamma(\sigma)}{1 + (2a_L(\sigma)x_L + b_L(\sigma))\tan\gamma(\sigma)} = 2a_\sigma(L_0)x_L + b_\sigma(L_0)$$
(21)

In equation (21) all the polynomial coefficients and the gamma angles are already known. However we know that $\gamma(\sigma)$ is independent of the lift-off, and so we can generalise equation (21) to all lift-off values, L:

$$\frac{2a_L(\sigma)x_L + b_L(\sigma) - \tan\gamma(\sigma)}{1 + (2a_L(\sigma)x_L + b_L(\sigma))\tan\gamma(\sigma)} = 2a_\sigma(L)x_L + b_\sigma(L)$$
(22)

WO 03/034054 PCT/GB02/04531

- 21 -

where now the stress line coefficients and the intercept between this line and any lift-off line (RHS of equation (22)) must be established.

To do this we simply solve the simultaneous equations (22) using coefficients from 2 or 3 lift-off lines together with equations (2), (4), (5) and (6) to determine the stress line coefficients and intercept positions. Note that any x position, x_L , can be chosen on a lift-off line and the corresponding y position and stress line coefficients determined for that case.

Hence the position Z can be determined, eliminating the effect of any lift-off, and this can be related to 15 stress. The value of stress found in this way is, it will be appreciated, the uniaxial stress that would provide that value of the flux linkage signal. stresses are actually biaxial, then a further calibration must be carried out with a cross-shaped sample in a test riq, flux linkage signal measurements being made at the centre of the sample where the principal stress directions are aligned with the axes of the test rig. Hence a graph or map may be obtained for a range of values of stress on one principal axis (say the x-axis) and for a range of values of stress in the other 25 principal axis (say the y-axis), with contours each of which shows the values of biaxial stress that give a particular value of apparent uniaxial stress along the xaxis; and a similar map may be obtained with contours showing values of biaxial stress that give a particular value of apparent uniaxial stress along the y-axis. Hence from measurements of apparent uniaxial stress along the two principal stress axes obtained as described earlier, the biaxial stress can be determined.

It will again be appreciated that the biaxial stress may be determined either graphically or by calculation in this way. Apparent values of uniaxial stress (in MPa) may be used for this purpose, or alternatively the numerical value of the flux linkage signal (in mV), either the in-phase or quadrature value, obtained by eliminating the effect of lift-off as described in relation to figure 3, may be used.

10 For some materials, such as hard steel, the biaxial stress contours for different values of apparent uniaxial stress (or of flux linkage signal) along the x-axis, and those along the y-axis, intersect at large angles over the entire biaxial stress plane. Finding the 15' intersection of two such contours, and so the true value of the biaxial stress, can be done easily. However for mild steel the two sets of contours (particularly in the tensile/tensile quadrant) are almost parallel, so it is very difficult to locate their intersection. case measurements with a different stress-dependent 20 variable are helpful, as they can provide a third set of contours; the flux rotation signals are desirably used for this purpose.

It will be appreciated that the invention enables lift-off to be distinguished from changes in material properties (such as stress), over a wide range of values of both lift-off and material properties, as it does not require an assumption that the changes are linear in the impedance plane. The probe described above is just one type of electromagnetic probe for which the invention is applicable. The electromagnet means may include a ferromagnetic core on which a drive coil is wound, such as a C-core or a rod, or may be air cored. The sensor may be a sensing coil wound on the same core, or a sensing coil positioned near to a pole, or may indeed be the same

coil as the drive coil. There may also be several sensor coils, for example in an array.

Measurements of lift-off require at least a region 5 of surface on which there is no coating, either on the object 16 or on a test piece of the same material, so that a measurement at zero lift-off can be made. Subsequently the thickness of any coating of nonferromagnetic material can be measured, as it is equal to the lift-off if the probe is in contact with the coating. As a rule, a probe smaller than that described above would be more sensitive to lift-off and less sensitive to material properties, so that if the primary intention is to measure lift-off then a probe of external diameter say 8 mm or 4 mm might be used. The shape of a surface, for 15 example any undulations in the upper surface of a rail head, may therefore be measured in a non-contact fashion by scanning a single probe over the surface and monitoring the changes of lift-off determined as 20 described above; alternatively an array of probes might be used for this purpose, and might also be scanned in this fashion. When taking measurements on a surface that is curved, it is desirable for the face of the probe to have a similar curvature.

25

It will thus be appreciated that the present invention is particularly suited to the determination of stress in a ferromagnetic material, as changes in stress have a large effect on the relative permeability, μ_r , while having a negligible effect on conductivity. A single specimen can be used for generating the signal/stress data and the stress/lift-off data, by subjecting the specimen to a range of different uniaxial or biaxial stresses. The resulting data can subsequently be used in taking measurements on many different objects

of the same type of material. In general there is a need to determine three independent parameters - the direction of the principal axes, and the stresses along each principal axis. It is hence desirable, in general, to take measurements with different orientations of the probe.

Claims

- An apparatus comprising at least one probe (12) for measuring material properties in an object (16) of ferromagnetic material and/or measuring the lift-off of the probe (12) from the surface of the object (16), the or each probe (12) comprising an electromagnet means (26), means (30a) to generate an alternating magnetic field in the electromagnet means (26) and consequently in the object (16), and a magnetic sensor (30b) arranged to sense a magnetic field due to the electromagnet means; analysis means (20) for resolving signals from the magnetic sensor into a first component and a second component which are orthogonal in phase; and 15 characterised by means (20) for mapping the first and second components directly into material property and lift-off components; and means (20) for deducing a material property from the material property component so determined, and/or a lift-off value from the lift-off component so determined. 20
- A method using at least one probe (12) for measuring material properties in an object (16) of ferromagnetic material and/or measuring the lift-off of the probe (12)
 from the surface of the object (16), the or each probe (12) comprising an electromagnet means (26) and a magnetic sensor (30b) arranged to sense a magnetic field due to the electromagnet means, the method comprising arranging the probe (12) adjacent to the object (16) and activating the electromagnet means (26, 30a) so as to generate an alternating magnetic field in the electromagnet means (26) and consequently in the object (16), resolving signals from the magnetic sensor (30b) into a first component and a second component which are orthogonal in phase; and characterised by mapping the first and second components directly into material

property and lift-off components; and deducing a material property from the material property component so determined, and/or a lift-off value from the lift-off component so determined.

5

- 3. A method as claimed in claim 2 also comprising calibrating, with a specimen of the material, how the first and second components of the signal vary with lift-off (at a constant stress) and vary with stress (at a constant lift-off), and deducing from the calibration measurements the applicable mapping for any stress and any lift-off.
- 4. A method as claimed in claim 3 wherein the contours

 in the impedance plane representing signal variation with
 lift-off (for different values of stress) and the
 contours representing signal variation with stress (for
 different values of lift-off), are curved, the contours
 of one set intersecting the contours of the other set at
 non-orthogonal angles.
- 5. A method as claimed in any one of claims 2 to 4 wherein the two sets of contours intersect at a constant angle along any one contour representing signal variation 25 with lift-off.
 - 6. A method as claimed in any one of claims 2 to 5 wherein the electromagnet means comprises an electromagnetic core (26) and two spaced apart
 0 electromagnetic poles (28), and the magnetic sensor (30b) is arranged to sense the reluctance of that part of the magnetic circuit between the poles (28) of the electromagnet means.
- 35 7. A method as claimed in claim 6 comprising taking such measurements on the object with a plurality of

different orientations of the magnetic field, at a single location on the object.

- 8. A method as claimed in claim 4 or claim 5 wherein the contours are represented by polynomials in performing the mapping.
- A method as claimed in claim 5 wherein the contours are presented by polynomials in performing the mapping,
 the constant intersection angle along a contour representing signal variation with lift-off being taken into account in generating the polynomials.

1/2



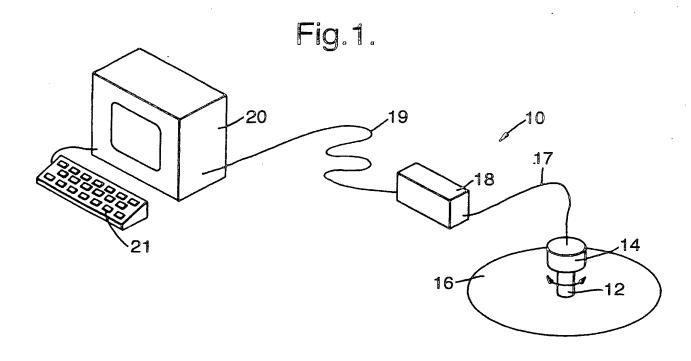


Fig.2.

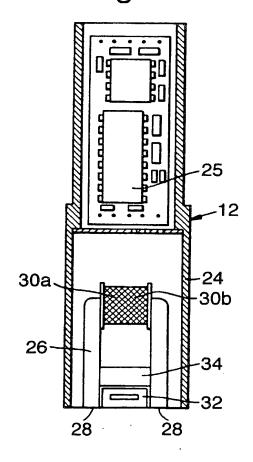

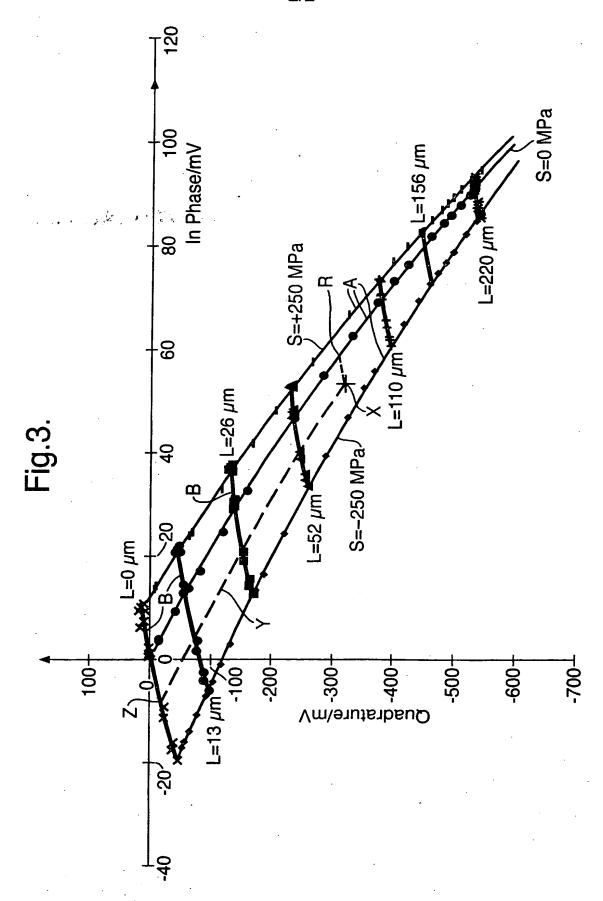

THIS PAGE BLANK (USPTO)

(19) World Intellectual Property Organization International Bureau





(43) International Publication Date 24 April 2003 (24.04.2003)

PCT

(10) International Publication Number WO 03/034054 A3

(51) International Patent Classification⁷: G01N 27/90, 27/83

(21) International Application Number: PCT/GB02/04531

(22) International Filing Date: 7 October 2002 (07.10.2002)

(25) Filing Language:

English

(26) Publication Language:

English

(30) Priority Data:

0124910.1 0208960.5 17 October 2001 (17.10.2001) GB 19 April 2002 (19.04.2002) GB

- (71) Applicant (for all designated States except US): AEA TECHNOLOGY PLC [GB/GB]; 329 Harwell, Didcot, Oxfordshire OX11 0QJ (GB).
- (72) Inventor; and
- (75) Inventor/Applicant (for US only): BUTTLE, David, John [GB/GB]; 29 Upthorpe Drive, Wantage, Oxfordshire OX12 7DF (GB).


- (74) Agents: MANSFIELD, Peter, Turquand et al.; c/o Accentus plc, Patents Dept, 329 Harwell, Didcot, Oxfordshire OX11 0QJ (GB).
- (81) Designated States (national): AE, AG, AL, AM, AT, AU, AZ, BA, BB, BG, BR, BY, BZ, CA, CH, CN, CO, CR, CU, CZ, DE, DK, DM, DZ, EC, EE, ES, FI, GB, GD, GE, GH, GM, HR, HU, ID, IL, IN, IS, JP, KE, KG, KP, KR, KZ, LC, LK, LR, LS, LT, LU, LV, MA, MD, MG, MK, MN, MW, MX, MZ, NO, NZ, OM, PH, PL, PT, RO, RU, SD, SE, SG, SI, SK, SL, TJ, TM, TN, TR, TT, TZ, UA, UG, US, UZ, VN, YU, ZA, ZM, ZW.
- (84) Designated States (regional): ARIPO patent (GH, GM, KE, LS, MW, MZ, SD, SL, SZ, TZ, UG, ZM, ZW), Eurasian patent (AM, AZ, BY, KG, KZ, MD, RU, TJ, TM), European patent (AT, BE, BG, CH, CY, CZ, DE, DK, EE, ES, FI, FR, GB, GR, IE, IT, LU, MC, NL, PT, SE, SK, TR), OAPI patent (BF, BJ, CF, CG, CI, CM, GA, GN, GQ, GW, ML, MR, NE, SN, TD, TG).

Declarations under Rule 4.17:

 as to applicant's entitlement to apply for and be granted a patent (Rule 4.17(ii)) for the following designations AE, AG, AL, AM, AT, AU, AZ, BA, BB, BG, BR, BY, BZ, CA,

[Continued on next page]

(54) Title: METHOD AND APPARATUS FOR MEASURING MATERIAL PROPERTIES AND LIFT-OFF COMPONENTS OF AN OBJECT USING A MAGNETIC PROBE

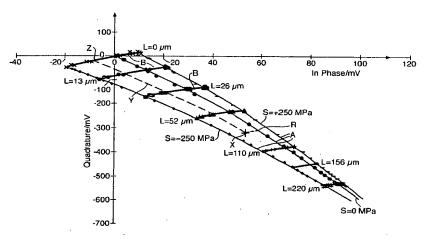

(57) Abstract: Method and apparatus for measuring material properties such as stress in a ferromagnetic material using an electromagnetic probe. While generating an alternating magnetic field in the object, and sensing the resulting magnetic field with a sensor, the signals from the magnetic sensor may be resolved into in-phase and guadrature components. The signals are affected by both geomaterical parameters such as lift-off any by material properties, but these influences may be separated by mapping the in-phase and quadrature components directly into material property and lift-off components, and hence a material property and/or the lift-off may be determined. The mapping may be represented in the impedance plane as two sets of contours representing signal variation with lift-off (A) (for different values of stress) and signal variation with stress (B) (for different values of lift-off), the contours of both sets (A, B) being curved. The stress contours (B) at a constant angle. Hence calibration measurements taken along a few contours of each set enable the positions of the other contours of each set to be determined.

VO 03/034054 /

CH. CN. CO. CR. CU, CZ. DE, DK, DM, DZ, EC, EE, ES, FI. GB, GD, GE, GH, GM, HR, HU, ID, IL. IN, IS, JP, KE, KG, KP, KR, KZ. LC, LK, LR, LS, LT, LU, LV, MA, MD, MG, MK, MN, MW, MX, MZ, NO, NZ, OM, PH, PL, PT, RO, RU, SD, SE, SG, SI, SK, SL, TJ, TM, TN, TR, TT, TZ, UA, UG, UZ, VN, YU, ZA, ZM, ZW, ARIPO patent (GH, GM, KE, LS, MW, MZ, SD, SL, SZ, TZ, UG, ZM, ZW). Eurasian patent (AM, AZ, BY, KG, KZ, MD, RU, TJ, TM), European patent (AT, BE, BG, CH, CY, CZ, DE, DK, EE, ES, FI, FR, GB, GR, IE, IT, LU, MC, NL, PT, SE, SK, TR), OAPI patent (BF, BJ, CF, CG, CI, CM, GA, GN, GQ, GW, ML, MR, NE, SN, TD, TG)

— of inventorship (Rule 4.17(iv)) for US only

Published:

- with international search report
- before the expiration of the time limit for amending the claims and to be republished in the event of receipt of amendments

(88) Date of publication of the international search report: 12 September 2003

For two-letter codes and other abbreviations, refer to the "Guidance Notes on Codes and Abbreviations" appearing at the beginning of each regular issue of the PCT Gazette.

INTERNATIONAL SEARCH REPORT

Intel Inal Application No PCT/GB 02/04531

A. CLASSIFICATION OF SUBJECT MATTER IPC 7 G01N27/90 G01N27/83

According to International Patent Classification (IPC) or to both national classification and IPC

B. FIELDS SEARCHED

Minimum documentation searched (classification system followed by classification symbols) IPC 7-601N

Documentation searched other than minimum documentation to the extent that such documents are included in the fields searched

Electronic data base consulted during the international search (name of data base and, where practical, search terms used)

EPO-Internal, PAJ, WPI Data

| C. DOCUM | ENTS CONSIDERED TO BE RELEVANT | |
|------------|--|-----------------------|
| Category ° | Citation of document, with indication, where appropriate, of the relevant passages | Relevant to claim No. |
| X | EP 0 631 147 A (PROMETRIX CORP) 28 December 1994 (1994-12-28) abstract; figures 2,3,6,7 column 2, line 41 -column 8, line 43 | 1-9 |
| Х | US 5 541 510 A (DANIELSON TIM) 30 July 1996 (1996-07-30) abstract; figures 1-7 column 3-8 | 1-5 |
| Х | US 5 341 678 A (KERVINEN JOHN A) 30 August 1994 (1994-08-30) abstract; figures 1,3 column 1-5 | 1-5 |
| X | US 3 358 225 A (PEUGEOT RICHARD S) 12 December 1967 (1967-12-12) column 1-5; figures 1-3 | 1-5 |
| 1 | -/ | |

| X Further documents are listed in the continuation of box C. | Palent family members are listed in annex. |
|---|--|
| Special categories of cited documents: 'A' document defining the general state of the art which is not considered to be of particular relevance 'E' earlier document but published on or after the international filing date 'L' document which may throw doubts on priority claim(s) or which is cited to establish the publication date of another cliation or other special reason (as specified) 'O' document referring to an oral disclosure, use, exhibition or other means 'P' document published prior to the international filing date but later than the priority date claimed | *T* later document published after the international filling date or priority date and not in conflict with the application but cited to understand the principle or theory underlying the invention *X* document of particular relevance; the claimed invention cannot be considered novel or cannot be considered to involve an inventive step when the document is taken alone *Y* document of particular relevance; the claimed invention cannot be considered to involve an inventive step when the document is combined with one or more other such documents, such combination being obvious to a person skilled in the art. *&* document member of the same patent family |
| Date of the actual completion of the international search | Date of mailing of the international search report |
| 16 July 2003 | 23/07/2003 |
| Name and mailing address of the ISA | Authorized officer |
| European Patent Office, P.B. 5818 Patentlaan 2 NL - 2280 HV Rijswijk Tel. (+31-70) 340-2040, Tx. 31 651 epo nl, Fax: (+31-70) 340-3016 | Klein, M-O |

Form PCT/ISA/210 (second sheet) (July 1992)

BEST AVAILABLE COP'

INTERNATIONAL SEARCH REPORT

Inte onal Application No PCT/GB 02/04531

| Category Citation of document, with indication, where appropriate, of the relevant passages | | | PCT/GB 02/04531 |
|--|------------|--|-----------------------|
| X PATENT ABSTRACTS OF JAPAN vol. 013, no. 149 (P-855), 12 April 1989 (1989-04-12) & JP 63 311165 A (KAWASAKI STEEL CORP), 19 December 1988 (1988-12-19) abstract; figure 1 X. US 6 188 218 B1 (SCHLICKER DARRELL E ET AL) 13 February 2001 (2001-02-13) column 3-5; figure 2 column 7-10 A US 5 963 031 A (DE HALLEUX BENOIT ET AL) 1-9 5 October 1999 (1999-10-05) column 1-5; figures 1-3 A US 4 727 322 A (LONCHAMPT THIERRY ET AL) 1-7 23 February 1988 (1988-02-23) the whole document A US 5 828 211 A (BUTTLE DAVID JOHN ET AL) 1-7 27 October 1998 (1998-10-27) the whole document A EP 0 282 930 A (TORNBLOM BENGT HJALMAR) 1-7 21 September 1988 (1988-09-21) | C.(Continu | | |
| vol. 013, no. 149 (P-855), 12 April 1989 (1989-04-12) & JP 63 311165 A (KAWASAKI STEEL CORP), 19 December 1988 (1988-12-19) abstract; figure 1 X. US 6 188 218 B1 (SCHLICKER DARRELL E ET AL) 13 February 2001 (2001-02-13) column 3-5; figure 2 column 7-10 A US 5 963 031 A (DE HALLEUX BENOIT ET AL) 1-9 5 October 1999 (1999-10-05) column 1-5; figures 1-3 A US 4 727 322 A (LONCHAMPT THIERRY ET AL) 1-7 23 February 1988 (1988-02-23) the whole document A US 5 828 211 A (BUTTLE DAVID JOHN ET AL) 1-7 27 October 1998 (1998-10-27) the whole document A EP 0 282 930 A (TORNBLOM BENGT HJALMAR) 1-7 21 September 1988 (1988-09-21) | Category ° | Citation of document, with indication, where appropriate, of the relevant passages | Relevant to claim No. |
| AL) 13 February 2001 (2001-02-13) column 3-5; figure 2 column 7-10 A US 5 963 031 A (DE HALLEUX BENOIT ET AL) 5 October 1999 (1999-10-05) column 1-5; figures 1-3 A US 4 727 322 A (LONCHAMPT THIERRY ET AL) 23 February 1988 (1988-02-23) the whole document A US 5 828 211 A (BUTTLE DAVID JOHN ET AL) 27 October 1998 (1998-10-27) the whole document A EP 0 282 930 A (TORNBLOM BENGT HJALMAR) 21 September 1988 (1988-09-21) | X | vol. 013, no. 149 (P-855), 12 April 1989 (1989-04-12) & JP 63 311165 A (KAWASAKI STEEL CORP), 19 December 1988 (1988-12-19) | 1,2 |
| 5 October 1999 (1999-10-05) column 1-5; figures 1-3 | Χ. | AL) 13 February 2001 (2001-02-13) column 3-5; figure 2 | 1,2 |
| 23 February 1988 (1988-02-23) the whole document A US 5 828 211 A (BUTTLE DAVID JOHN ET AL) 27 October 1998 (1998-10-27) the whole document A EP 0 282 930 A (TORNBLOM BENGT HJALMAR) 21 September 1988 (1988-09-21) | A | 5 October 1999 (1999-10-05) | 1-9 |
| 27 October 1998 (1998-10-27) the whole document A EP 0 282 930 A (TORNBLOM BENGT HJALMAR) 21 September 1988 (1988-09-21) | A | 23 February 1988 (1988-02-23) | 1-7 |
| 21 September 1988 (1988-09-21) | Α | 27 October 1998 (1998-10-27) | 1-7 |
| | Α | 21 September 1988 (1988-09-21) | 1–7 |
| | | - | |
| | | | |
| | | | |
| | | | |
| | | | · |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | · |
| | | | |

Form PCT/ISA/210 (continuation of second sheet) (July 1992)

BEST AVAILABLE COP

INTERNATIONAL SEARCH REPORT

Information on patent family members

Inte onal Application No PCT/GB 02/04531

| Patent document cited in search report | Publication date | Patent family member(s) | Publication date |
|--|------------------|---|--|
| EP 0631147 A | 28-12-1994 | US 5552704 A EP 0631147 A1 JP 2952156 B2 JP 7098299 A | 03-09-1996 28-12-1994 20-09-1999 11-04-1995 |
| US 5541510 A | 30-07-1996 | DE 19610844 A1 | 10-10-1996 |
| US 5341678 A | 30-08-1994 | EP 0627609 A1 JP 7071905 A | 07-12-1994 17-03-1995 |
| US 3358225 A | 12-12-1967 | NONE | |
| JP 63311165 2 5 A | 19-12-1988 | NONE | |
| US 6188218 B1 | 13-02-2001 | AU 1367199 A CA 2308166 A1 EP 1027598 A1 WO 9922231 A1 | 17-05-1999 06-05-1999 16-08-2000 06-05-1999 |
| US 5963031 A | 05-10-1999 | AU 700581 B2 AU 6356796 A BR 9608666 A DE 69602841 D1 DE 69602841 T2 WO 9701739 A1 EP 0835422 A1 SK 141697 A3 ZA 9605179 A | 07-01-1999 30-01-1997 04-05-1999 15-07-1999 30-12-1999 16-01-1997 15-04-1998 06-05-1998 25-09-1997 |
| US 4727322 A | 23-02-1988 | FR 2574938 A1 DE 3565895 D1 EP 0187094 A1 | 20-06-1986 01-12-1988 09-07-1986 |
| US 5828211 A | 27-10-1998 | AT 156268 T AU 6661294 A DE 69404650 D1 DE 69404650 T2 DK 699301 T3 EP 0699301 A1 WO 9428407 A1 GB 2278450 A , B JP 8508343 T | 15-08-1997 20-12-1994 04-09-1997 11-12-1997 02-03-1998 06-03-1996 08-12-1994 30-11-1994 03-09-1996 |
| EP 0282930 A | 21-09-1988 | SE 456865 B EP 0282930 A2 JP 63308556 A SE 8701082 A US 4864235 A | 07-11-1988 21-09-1988 15-12-1988 18-09-1988 05-09-1989 |

Form PCT/ISA/210 (patent family annex) (July 1992)



THIS PAGE BLANK (USETLE)